


BURNISHERS

Parts for P1000, P1200 and P2000

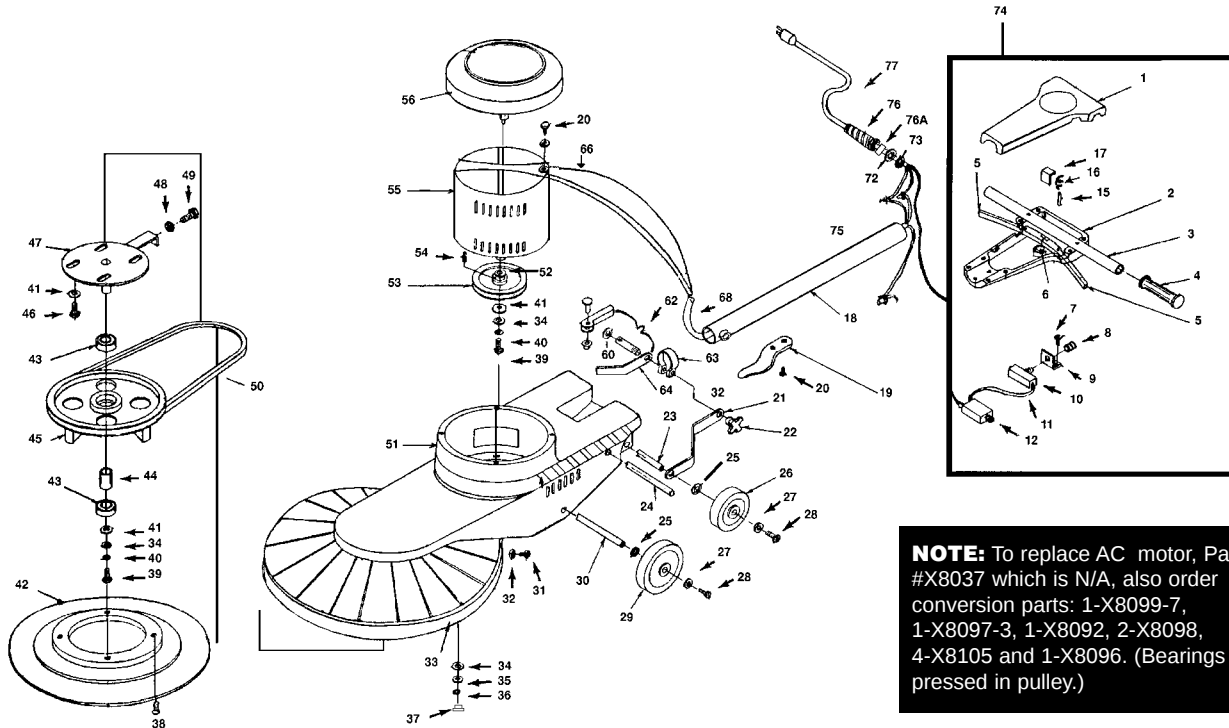

NOTE: To replace AC motor, Part #X8037 which is N/A, also order conversion parts: 1-X8099-7, 1-X8097-3, 1-X8092, 2-X8098, 4-X8105 and 1-X8096. (Bearings are pressed in pulley.)

ref#	order	description	each
1	X8001	handle cover (front)	11.84
2	X8002	handle cover (back)	11.84
3	X8005	cross bar handle	9.84
4	X8007	handle grip	2.59
5	X8003	switch lever	6.09
6	X8004	lock out ball	1.27
7	X8201	8-32 X 3/8" type "F" screw	.18
8	X8010	switch spring	.37
9	X8006	switch bracket	2.54
10	F5P	switch (25 amp)	7.99
11	X8009	4" jumper wire	.77
12	X8023	15 amp circuit breaker (P1000, P1200)	9.83
15	X8026	Dowell pin	.77
16	X8110	Dowell pin spring	.99
17	X8061	clip, switch lever	.64
18	X8011B	handle tube with inserts	36.51
	X8011	handle tube (P2000) without inserts	36.51
19	X8013	cord hook	4.20
20	X8207	10-24 x 1/2" type "F" phil screw	.11
21	X8027L	handle brace (left)	9.54
22	X8016	knob	2.67
23	X8029	rear axle	6.57
24	X8018	pivot shaft	8.11
25	X8101	spring washer	.21
26	X8025	4" wheel	10.75
27	X8020	axle washer	.74
28	X8210	1/4 - 20 x 1/2" phil flat head screw	.33
29	X8024	5" wheel	14.06
30	X8095	axle (main wheels)	7.60
31	X8208	10-24 x 5/8" phil pan head screw	.13
32	X8225	3/16" flat washer	.11
33	X8030	46" bumper	10.08
34	X8219	3/8" SAE flat washer	.11
35	X8218	5/16" SAE flat washer	.11
36	X8212	1/4" lock washer	.11
37	X8211	1/4-20 x 1 hex cap bolt	.11
*38	X8216	5/16-18 x 1-1/2" flat phil (pad holder)	.25
39	X8215	5/16-18 x 3/4" hex cap bolt	.17
40	X8217	5/16" split lock washer	.11
41	X8230	3/8" wrought washer	.08
42	X8862	flexible pad driver	63.16
43	X8098	bearing	7.75
44	X8092	bearing spacer	1.48
45	X8096	main pulley	45.69
46	X8223	3/8-16 x 3/4" hex end cap screw	.17
47	X8091	shaft & plate weldment	27.76
48	X8231	5/16-18 hex nut	.11
49	X8227	5/16-18 x 1-1/4" hex tap bolt	.17
50	X8099	43" vee belt (P1200)	14.36
	X8099-2	41" vee belt (P1600)	14.36

ref#	order	description	each
	X8099-4	42" belt for P2000 with Type B pulley	14.36
	X8099-5	40.5" belt for P1000, P1600 with Type B pulley	14.36
	X8099-7	39.5" belt for P1200 with Type B pulley	14.36
51	X8050	base housing	187.91
52	X8170	3/4" USS washer, plated	.18
53	X8097-1	pulley for P2000	37.85
	X8097-2	pulley for P1000, P1600	34.84
	X8097-3	pulley for P1200	31.97
54	X8047	machine key	.33
55	X8037-1	1-1/2 H.P., 115V, rectified D.C. motor	521.09
	X8078	1 H.P., 115V, rectified D.C. motor (P1000 only)	370.01
56	X8041	motor cover	16.73
60	X8028	1/2" hardened washer	.47
62	X8012A	handle clamp assembly	15.90
63	X8012	handle clamp, collar, 1-1/2"	10.23
64	X8027R	handle brace (right)	9.54
66	X8021	12" ground wire	.42
67	X8150	cable tie	.22
68	X8022B	line cord	9.04
69	X8202	8-32 x 1/2" phil pan bolt	.08
70	X8150M	cable tie mount	.22
71	X8256	8-32 keep nut	.11
72	X8228	11/16 I.D. flat washer	.22
73	X8100	counter nut	1.06
74	X8600	switch housing, complete with switch and circuit breaker comes with X8023A for P100-1500	94.41
75	X8062W	counter weight (P2000)	4.86
76	SR37	strain relief, metal	(10) 3.57
76A	SR37A	brass sleeve, strain relief	1.27
77	M1400	14/3, SJTWA 75' cord	25.25
	M1400S	cord with strain relief	28.43
	M1407	12/3, SJWA, 75' cord (P2000)	(4) 37.44
	M1407FS	12/3, SJWA, 75' cord w/metal relief	46.26
NOT ILLUSTRATED			
	X8062W	handle weight, P2000	4.86
	X8213	nut for X8210-1	.30
	X8222	1/4" x 20 x 3/4" socket set screw for X8011 handle	.11
	X8038	60 MFD capacitor AC motor only	22.54
	X8039	340 MFD capacitor AC motor only	5.79
	X8512	carbon brush, for P1000, P1200 and P1600	4.71
	F45P	pad holder center grip	(10)8.80 (5)9.21
	X8108	wheel spacer	.11
	X8034-2	50 amp, 60 cycle rectifier	27.81
	X8180	bottom bearing P1600, P2000	20.66
	X8535	upper motor bearing	9.45
	X8210-1	screw & nut	.30
	X8220	#14 x 1/2" phil flat head	.33

Call Toll Free 800.880.2913

Visit Our Website at www.powrflite.com